

Work Safety Alert Fallen from a Bamboo Scaffold Under Erection


1. **Date of Accident :** December 2022
2. **Place of Accident :** A residential building
3. **Summary :**

A scaffolder while erecting a bamboo scaffold at the external wall of a 3-storey residential building under renovation plunged to death from the scaffold onto the ground for a distance of about 3m.

4. **Work Safety Alert for Contractors/ Employers :**

To prevent any workers/ employees from falling from height, contractors/ employers engaged in erection/ dismantling/ alteration of bamboo scaffolds should:

- appoint a competent person to conduct task-specific risk assessments to identify all potential hazards associated with the work, taking into accounts the nature of work and the work environment;
- formulate safe work methods and procedures for the work with due regard to the results of risk assessments, which should comply with the requirements of safety legislation, relevant code of practice and guidelines;
- provide and properly maintain suitable and adequate safe means of access to and egress from every place of work for the workers/ employees;
- ensure that scaffolds are erected/ dismantled/ altered by trained workmen with adequate experience under the immediate supervision of a competent person;
- provide every worker/ employee involved in the work with a suitable

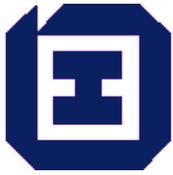

safety harness that is attached continuously to a suitable and secure anchor point, an independent lifeline or a fall arresting system, and ensure the proper use of them by the workers/ employees concerned throughout the work;

- ensure that all components of the fall protection system are able to withstand any loads or forces that might be imposed on them and should be such that they cannot be accidentally removed, dislodged or become unfastened;
- ensure that the lanyards used in the fall protection system comply with international standards and are securely connected to an anchor point, an independent lifeline or a fall arresting system in accordance with manufacturer's instructions in a manner that safeguards a person in case of fall;
- ensure that every independent lifeline is suitably positioned and extended to a level enabling the use of which by the worker/ employee concerned to reach any place he/ she is expected to work;
- provide each worker/ employee involved in the work with a suitable safety helmet equipped with a chin strap and ensure the proper wearing of the same by the workers/ employees throughout the work;
- provide all workers/ employees involved with necessary safety information, instruction and training, and ensure that they are familiar with the safe work procedures and relevant safety measures; and
- establish and implement an effective monitoring and control system to ensure all safety measures are strictly followed.

5. Reference :

- [A Guide to the Provisions for Safe Places of Work under Part VA of the Construction Sites \(Safety\) Regulations¹](#)

● ¹ Click to view document



- [Code of Practice for Bamboo Scaffolding Safety](#)¹
- [Guidance Notes on Classification and Use of Safety Belts and their Anchorage System](#)¹
- [A Casebook of Fatal Accidents related to Work-at-height](#)¹

DISCLAIMER

This Work Safety Alert (“the Alert”) is issued at the earliest possible opportunity after a serious accident with a view to drawing the attention of interested parties to the general safety precautionary measures necessary to protect people engaging in similar work activities. The material contained in the Alert constitutes general guidance only. It does not reduce, limit, or replace, any legal obligations upon any person to comply with any statutory duties under relevant legislation. Users such as Managers and Supervisors should make their own evaluation of the information contained in the Alert to determine if it can be applied to their own situations and practices. The Labour Department does NOT accept any responsibilities for any loss or damage resulting from the use of or failure to use of the information on the Alert.

Note: The material contained in the Alert is not exhaustive, and will be supplemented/ adjusted where necessary if more relevant information comes to light.